

CONTINENTAL MOTORS® AIRCRAFT ENGINE
CRITICAL SERVICE BULLETIN
COMPLIANCE NECESSARY TO MAINTAIN SAFETY

Category 2
CSB07-2A

Supersedes CSB07-2
 TECHNICAL PORTIONS
FAA APPROVED

SUBJECT: Turbocharger Wastegate Oil Inlet Fitting Inspection and Replacement

PURPOSE: To provide instructions for the inspection of the turbocharger wastegate oil inlet fitting for possible chafing on the adjacent structure and to provide instructions for fitting replacement.

COMPLIANCE: Prior to the next aircraft flight.

MODELS

AFFECTED: TSIO-360-RB; LTSIO-360-R: See Serial Number Listing

GENERAL

Continental Motors (CM) has received a report from the field of possible interference between the turbocharger wastegate oil inlet fitting and the adjacent airframe engine mount structure. Damage to the wastegate oil inlet fitting could lead to fitting fracture and subsequent loss of engine oil.

WARNING


Loss of engine oil could lead to internal engine damage, loss of engine power, engine failure, damage to the airframe, personal injury or death.

All new TSIO-360-RB engines (S/N 322761 to S/N 322793) and new LTSIO-360-RB engines (S/N 322516 to 322546) that were shipped from the Continental Motor’s factory to Piper Aircraft Inc. for installation in new aircraft **must** be inspected **prior to further flight** in accordance with the instructions contained in this Critical Service Bulletin.

In addition: All new LTSIO-360-RB engines S/N 322526 to S/N 322555;
 All rebuilt LTSIO-360-RB engines S/N 819525 to S/N 819533
 All new TSIO-360-RB engines S/N 322777 to S/N 322802
 All rebuilt TSIO-360-RB engines S/N 819275 to S/N 819282
 that were sold through an authorized CM distributor for aftermarket installation **must** be inspected **prior to further flight** in accordance with the instructions contained in this Critical Service Bulletin.

WARRANTY

1. CM will reimburse the inspection portion of this bulletin for up to 0.5-hour labor per engine at the posted shop labor rate. Labor warranty may be filed through any CM authorized distributor.
2. Parts, shipping and an additional 1.5-hours’ labor at the posted shop labor rate will be reimbursed under warranty for each engine requiring fitting replacement.


ISSUED			REVISED			 P.O. Box 90 Mobile Alabama 36601 251-436-8299	PAGE NO	REVISION
MO	DAY	YEAR	MO	DAY	YEAR		1 of 6 CSB07-2	A
05	25	2007	06	16	2016			

INSPECTION PROCEDURES

1. Using the airframe manufacturer's maintenance instructions, open or disconnect each engine cowl flap to allow access to the wastegate actuator. (Reference Figure 1)
2. Inspect the oil inlet fitting of the wastegate actuator.
3. If the fitting is a one-piece 90° fitting as shown in Figure 2A, no further action is required. Reassemble the previously removed airframe components using the applicable airframe manufacturer's maintenance instructions. Make engine log book entries for each engine inspected certifying compliance with this Critical Service Bulletin.
4. If the fitting is a two-piece assembly (straight fitting and 90-degree fitting) as shown in Figure 2B, proceed to the fitting replacement instructions contained in this Critical Service Bulletin.

FITTING REPLACEMENT

1. Using the airframe manufacturer's maintenance instructions, open or disconnect the engine cowl flaps and remove the engine cowling as necessary to allow access to the wastegate actuator. (Reference Figure 1)
2. Disconnect the wastegate actuator oil inlet pressure hose P/N 646644S4S21.00 from the wastegate actuator by disconnecting hose from the wastegate oil inlet 90-degree fitting. Cap the hose to prevent contamination during the fitting replacement.
3. Remove the 90-degree fitting P/N MS51521B4, straight fitting MS51525B4, and O-ring seal P/N 630979-15 from the oil inlet on the wastegate and discard. (Reference Figure 3)
4. Inspect Hose P/N 646644S4S21.00 for any signs of chafing or damage to the fitting. Replace if any damage is noted.
5. Inspect the adjacent engine mount structure for any chafing damage from the wastegate actuator fitting or hose. If any damage to the engine mount structure is noted, inspect the damage per the applicable airframe manufacturer's maintenance instructions or contact Piper Customer Service at 1-772-978-6573.
6. Install replacement 90-degree fitting P/N AN833-4 with new O-ring P/N 630979-15 (O-Ring P/N MS28778-4 is an approved alternate) and jam nut P/N AN924-4. Lightly lubricate the O-ring with clean 50W engine oil before installation.
7. Clock the P/N AN833-4 fitting to allow connection of wastegate oil pressure hose while maintaining sufficient clearance between the fitting and the airframe engine mount structure. While holding the fitting in position to ensure clearance between the fitting and the airframe engine mount structure, ensure that the O-ring is seated in the relief boss on the fitting. Screw


ISSUED			REVISED			 P.O. Box 90 Mobile Alabama 36601 251-436-8299	PAGE NO	REVISION
MO	DAY	YEAR	MO	DAY	YEAR		2 of 6 CSB07-2	A
05	25	2007	06	16	2016			


the jam nut finger tight against the fitting boss. Torque the jam nut to 85-105 inch-pounds while holding the correct fitting orientation.

8. Install the wastegate oil pressure supply hose P/N 646644S4S21.00 to the wastegate oil inlet 90-degree fitting. Using a back-up wrench, torque hose fittings in accordance with the instructions contained in the latest revision of M-0, Standard Practice Maintenance Manual.
9. Using the airframe manufacturer's maintenance instructions, reassemble any removed airframe components and reinstall the cowling.
10. Perform an engine ground run using the airframe manufacturer's pilots operating handbook. After the ground run check all engine lubricating system fittings for leaks and verify clearance was maintained between the wastegate oil inlet fitting and the engine mount structure. Repair any leaks found prior to further flight.
11. Make an engine logbook entry certifying compliance with this Critical Service Bulletin.



**FIGURE 1
INSPECTION AREA**


ISSUED			REVISED			 P.O. Box 90 Mobile Alabama 36601 251-436-8299	PAGE NO	REVISION
MO	DAY	YEAR	MO	DAY	YEAR		3 of 6 CSB07-2	A
05	25	2007	06	16	2016			

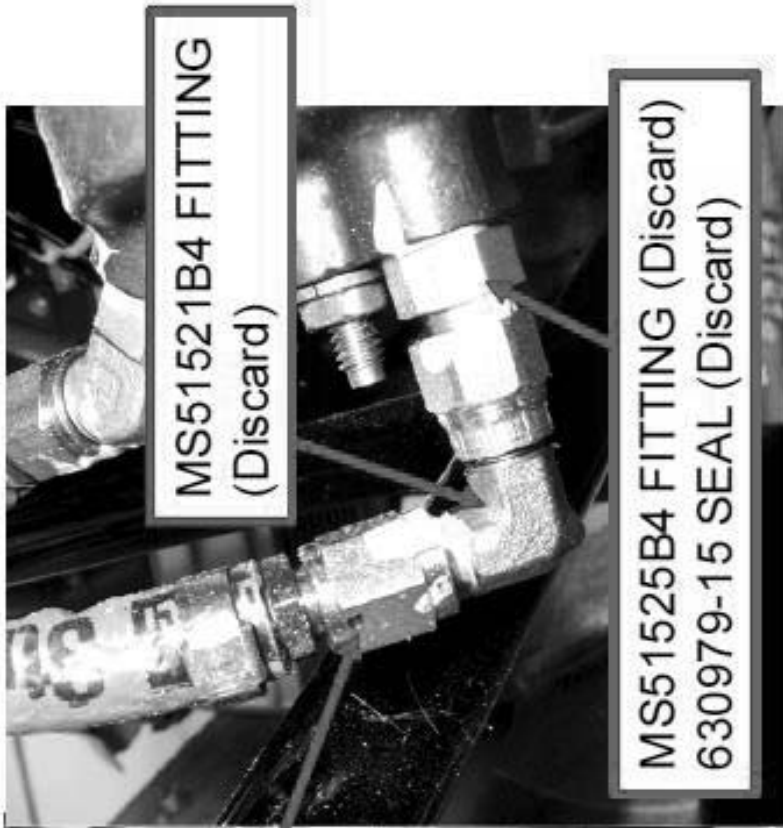

MS51521B4 FITTING
(Discard)

MS51525B4 FITTING (Discard)
630979-15 SEAL (Discard)

**FIGURE 2B
OLD INSTALLATION**

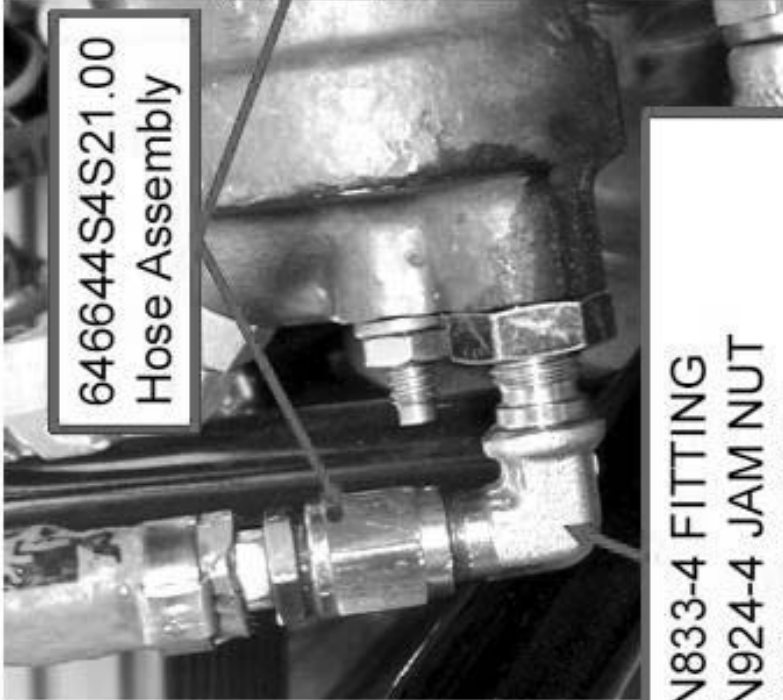

646644S4S21.00
Hose Assembly

AN833-4 FITTING
AN924-4 JAM NUT
630979-15 SEAL
(Alternate Seal MS28778-4)

**FIGURE 2A
NEW INSTALLATION**

ISSUED			REVISED			 P.O. Box 90 Mobile Alabama 36601 251-436-8299	PAGE NO	REVISION
MO	DAY	YEAR	MO	DAY	YEAR		4 of 6 CSB07-2	A
05	25	2007	06	16	2016			

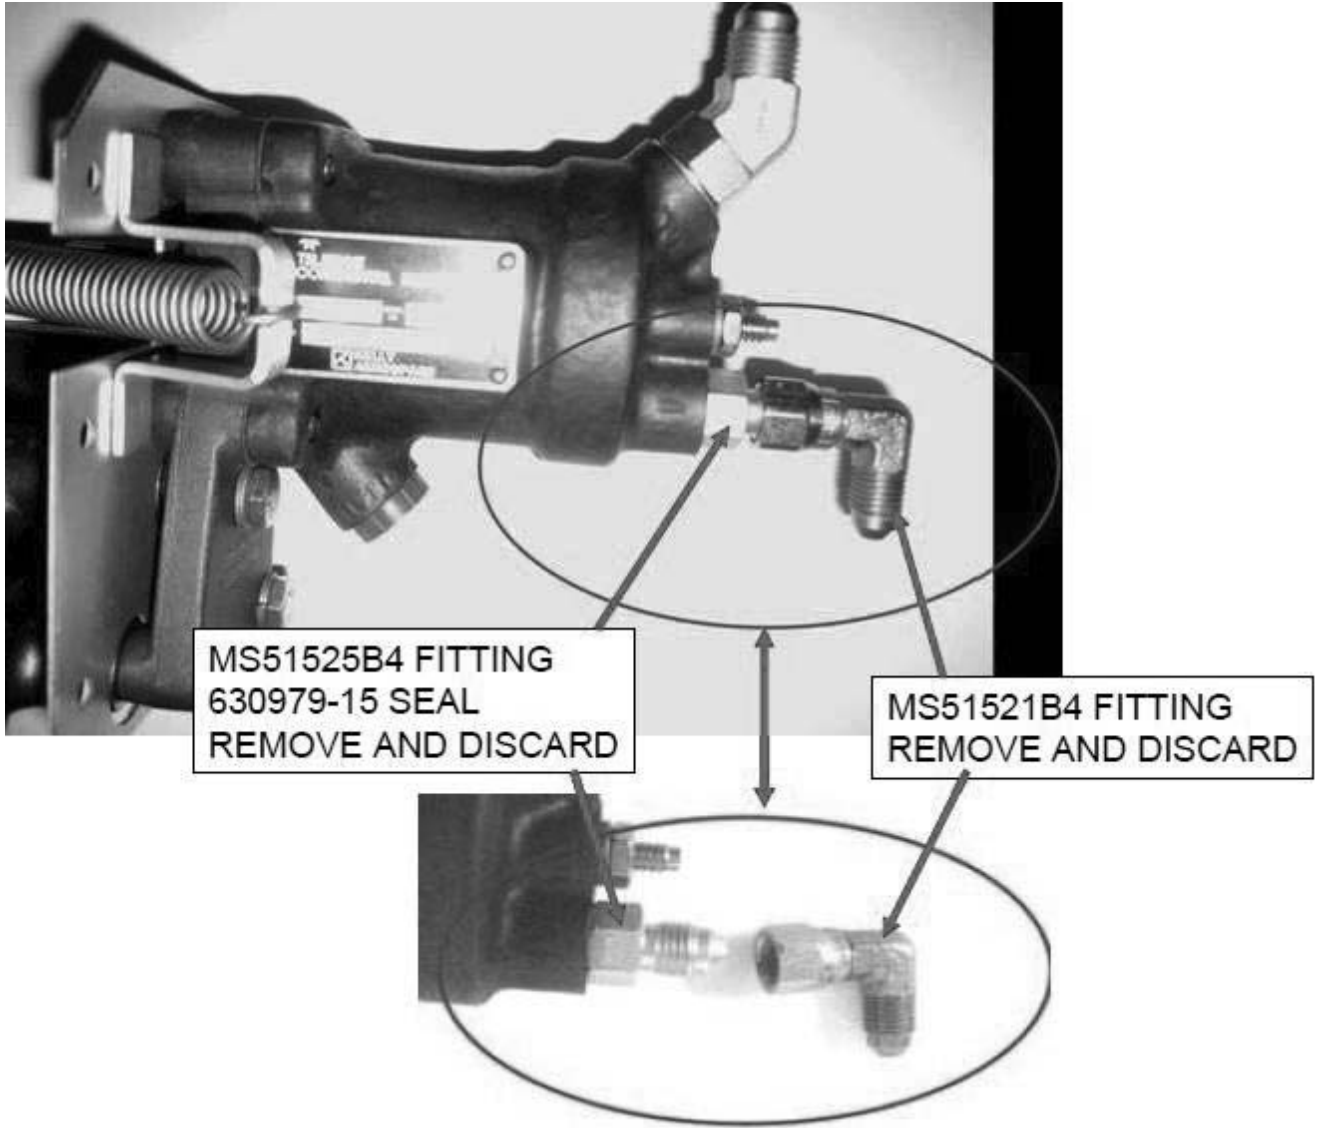




Figure 3
FITTING REPLACEMENT DETAIL

ISSUED			REVISED			 P.O. Box 90 Mobile Alabama 36601 251-436-8299	PAGE NO	REVISION
MO	DAY	YEAR	MO	DAY	YEAR		5 of 6 CSB07-2	A
05	25	2007	06	16	2016			

Intentionally Left Blank

ISSUED			REVISED			 P.O. Box 90 Mobile Alabama 36601 251-436-8299	PAGE NO	REVISION
MO	DAY	YEAR	MO	DAY	YEAR		6 of 6 CSB07-2	A
05	25	2007	06	16	2016			